

Issue:

The signal camera is green, striped or black.

Solution:


Adjust the output video signal from the camera.

The following file describes the procedure to adjust the video signal of the camera models **B8TURBO** and **D8TURBO**.

IMPORTANT NOTE: The DVR must have firmware version 3.1.7. (The firmware can be downloaded directly from our website www.syscom.mx typing the corresponding model in the search page)

Step 1

Right click on the camera and select the **PTZ Control**.

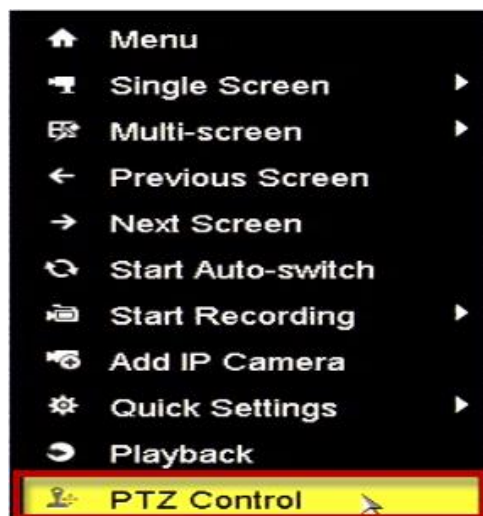


Step 2

Select **Menu** to enter the OSD menu of the camera.




Step 3

Select **VIDEO OUT** and click **Iris +**

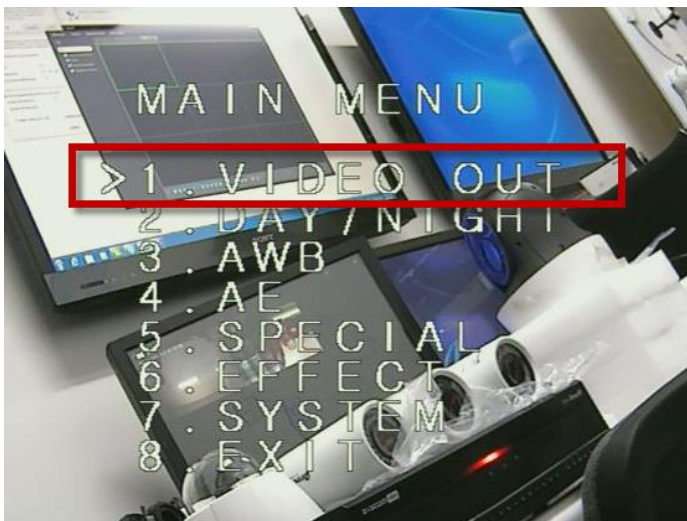


Step 4

Change the **FRAME RATE** to **25** and RETURN (to return to the previous menu).

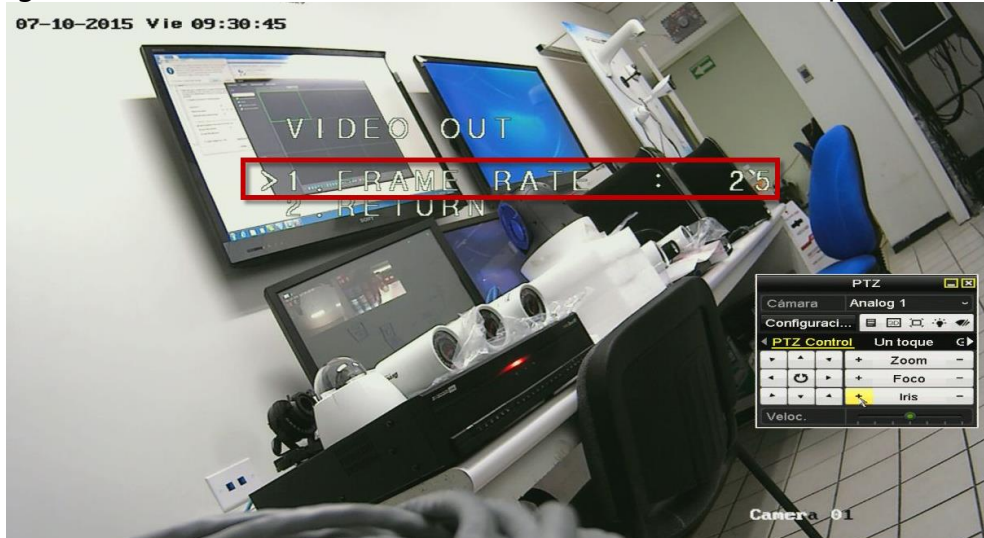

Step 5

Select **AE** and change the **FLICKER** to **60HZ**

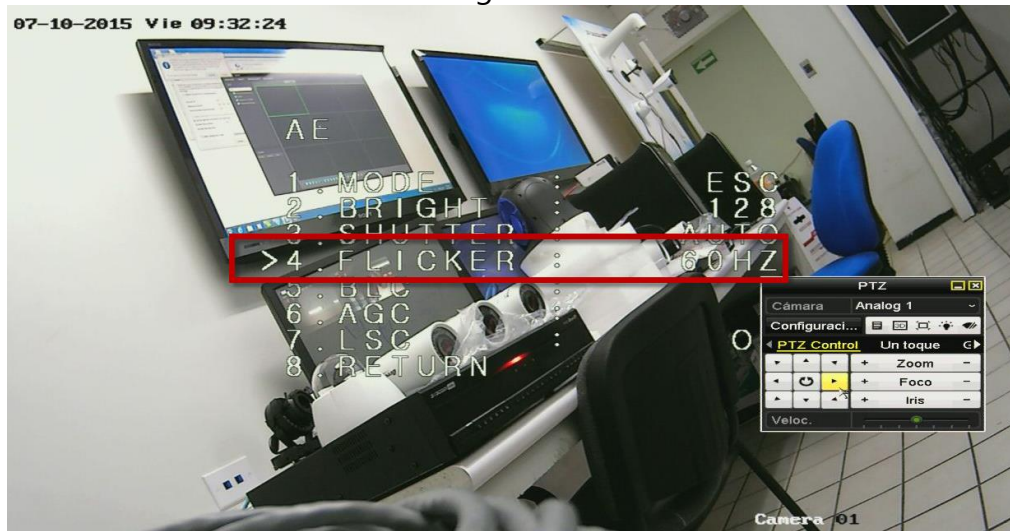

The adjustment applies to the following camera models:
B8TURBO, D8TURBO